



FELKER TRUCK AND EQUIPMENT INC

W9576 POKER FLATS DR PO BOX 139 DALE, WI 54931
OFFICE: 920-779-9826 WWW.FELKERTRUCK.COM

Invoice

Date	Invoice #
11/17/2022	105943

Please Reference Invoice Number with Payment

Bill To
New Horizons Energy LLC 1775 4th Street Fennimore, WI 53809-1137

Ship To
New Horizons Energy LLC 1775 4th Street Fennimore, WI 53809

Unit/VIN	Mileage	Terms	P.O. No.	Project
P19-6643/7J466643	295340	NET 15	STEVE LUCEY	HYDRO/REPAIRS
Qty	Description			Total
	A) GUEST STATES THAT THE UNIT IS DUE FOR THE HYDRO VK INSPECTION PERFORM 5-YEAR HYDROSTATIC TEST INSPECTION INCLUDING VISUAL AND LEAKAGE (V&K) INSPECTION. SERVICE INCLUDES BLOWING DOWN TANK, PRESSURE TEST AND DRY OUT THE TANK AND EQUIPMENT. METHANOL IS INDUCED INTO THE SYSTEM AT THE TIME OF REPURGE AND PRESSURIZE. UNIT IS PUMP TESTED AND RECHECKED FOR LEAKS. INCLUDES INSPECTION DATE DECAL, 2-2' REGO PRESSURE RELIEF VALVES, O-RING FOR PUMP OUTLET, PUMP INTERNAL BYPASS COVER AND O-RING FOR METER STRAINER COVER. THIS DOESN'T INCLUDE ANY REPAIRS TO MEET D.O.T. COMPLIANCE OR PROPANE FOR PURGING TANKS. NEEDS TO COME WITH 150 GALLONS OF PROPANE FOR PURGING AND TESTING THE PUMPING SYSTEM (INTERNAL INSPECTION IS AN ADDITIONAL CHARGE)			3,078.11
	ADDITION TO HYDRO ON BOBTAIL WITH MANWAY- TO REMOVE MANWAY, INSPECT THE INSIDE OF THE TANK, INSTALL NEW MANWAY GASKET, REINSTALL MANWAY AND TIGHTEN DOWN			
1.5	LABOR CHARGE P/HR SUMMARY: DURING HYDRO TECH FOUND THE FLOAT GAUGE TANK STUDS AND NUTS VERY CORRODED AND THIN. TECH REPLACED NEEDED STUDS AND NUTS. REASSEMBLED AND CHECKED FOR LEAKS. NO LEAKS FOUND.			
3	0056-00404 STUD/MOUNTING BOLT FOR MAGNETEL RR GAUGE			
8	0044-00403 NUT - 1/2-13 NC-2 STE EL CAD FOR RR GAUGE			
1	SPIROTALLIC GASKET (MAGGKT)			
	SUBTOTAL A			
	B) DURING INSPECTION TECH FOUND THAT THERE ARE ALOT RUSTY SPOTS ON THE TANK, ALSO THERES A CRACK ON THE PASSENGER FRONT PAD TO RAIL.			

WE THANK YOU FOR YOUR BUSINESS!

A 3% FEE WILL BE ADDED TO ALL INVOICES PAID WITH A CREDIT CARD

A FINANCE CHARGE OF 1.5% WILL BE APPLIED TO ALL PAST DUE INVOICES
ON THE 1ST OF EACH MONTH



**FELKER TRUCK AND
EQUIPMENT INC**
W9576 POKER FLATS DR PO BOX 139 DALE, WI 54931
OFFICE: 920-779-9826 WWW.FELKERTRUCK.COM

Invoice

Date	Invoice #
11/17/2022	105943

Please Reference Invoice Number with Payment

Bill To
New Horizons Energy LLC 1775 4th Street Fennimore, WI 53809-1137


Ship To
New Horizons Energy LLC 1775 4th Street Fennimore, WI 53809

Unit/VIN	Mileage	Terms	P.O. No.	Project
P19-6643/7J466643	295340	NET 15	STEVE LUCEY	HYDRO/REPAIRS
Qty	Description			Total
85.75	LABOR CHARGE P/HR SUMMARY: TECH DISCUSSED OPTIONS WITH GUEST. PERFORMED THICKNESS TEST AND FOUND MULTIPLE CORRODED SPOTS BELOW MIN THICKNESS. REMOVED TANK FROM CHASSIS TO GAIN ACCESS FOR WELD REPAIRS. SET ON STANDS AND TRAILER FOR WELDERS. WELDER PERFORMED WASTE WELD BUILD UP ON NEEDED SPOTS OF TANK. TECH WELDED UP CRACKS IN HOLD DOWN PADS. TALKED WITH GUEST ABOUT REAR COVER OVER PIPING. REMOVED COVER AND CUT OFF MOUNTS. RELOCATED WORK LIGHTS TO GAUGE RAIN COVER. SENT UNIT OUT FOR PAINT. AFTER PAINT REMOUNTED TANK TO CHASSIS AND REASSEMBLED ALL COMPONENTS. PRESSURIZED AND LEAK CHECKED. PUMP TEST AND NO LEAKS FOUND.			24,533.48
1	SENT OUT TO SUB-CONTRACTOR TO DO THE FOLLOWING			
1	INSPECTION FEE FOR WELD REPAIR BY SUBCONTRACTOR			
1	WELD REPAIR TO TANK AND INSPECTION FEE			
1	PREP/PRIME/PAINT USED TANK OPEN DECK LP TRUCK 1 COLOR:			
1	SAND BLAST TANK			
4	1/2 BOLT GRADE 8			
1	O'RING BLACKMER 1 1/4 BY PASS COVER STATIONARY			
26	5/8 GRADE 8 BOLT			
1	LC METER O'RING SEAL BUNA			
3	BUNA O'RING			
2	1/4 TUBE CLAMP			
4	1/8 GALVANIZED CABLE P/FT			
11	2 STRAND CABLE AP/FT			
1	SEALCO AIR TOGGLE SWITCH			
	SUBTOTAL B			
	C) DURING INSPECTION TECH FOUND SOME LEAKS IN THE SYSTEM PUMP BYPASS COVER, NOZZLE TO SWIVEL THREADS LEAK, BOTH REED PLATES ARE LEAKING, ALSO THE CHECK LOCK BUSHING THREADS TO TANK ARE LEAKING.			

WE THANK YOU FOR YOUR BUSINESS!

A 3% FEE WILL BE ADDED TO ALL INVOICES PAID WITH A CREDIT CARD

A FINANCE CHARGE OF 1.5% WILL BE APPLIED TO ALL PAST DUE INVOICES
ON THE 1ST OF EACH MONTH

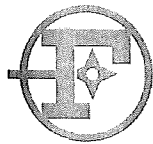

FELKER TRUCK AND EQUIPMENT INC

W9576 POKER FLATS DR PO BOX 139 DALE, WI 54931
OFFICE: 920-779-9826 WWW.FELKERTRUCK.COM

Invoice

Date	Invoice #
11/17/2022	105943

Please Reference Invoice Number with Payment

Bill To
New Horizons Energy LLC 1775 4th Street Fennimore, WI 53809-1137

Ship To
New Horizons Energy LLC 1775 4th Street Fennimore, WI 53809


Unit/VIN	Mileage	Terms	P.O. No.	Project
P19-6643/7J466643	295340	NET 15	STEVE LUCEY	HYDRO/REPAIRS

Qty	Description	Total
4	LABOR CHARGE P/HR SUMMARY: TECH PERFORMED REQUIRED LEAK REPAIRS ON UNIT. REPLACED O-RINGS ON BYPASS COVER. RESEALED THREADS ON NOZZLE SWIVEL. REPLACED REED PLATES ON VAPOR ELIMINATOR. REMOVED CHECK LOC AND CLEANED THREADS. RESEALED AND INSTALLED. TECH FOUND METER INLET BACK CHECK BOLTS RUSTED THIN. TOOK EXTRA TIME TO REMOVE AND REPLACE BOLTS FOR BACK CHECK FLANGE. RECHECKED FOR LEAKS AND NO LEAKS FOUND.	
4	3/8"-16 x 4-1/2" Grade 8 Yellow Zinc Finish Hex Cap Screw	
2	METER SEAL O'RING BUNA MULTI SHAPE	
1	METER VAPOR REED PLATE LPG	
1	METER VALVE REED PLATE LPG WITH HOLE	
1	03:702004 O-RING - BLACKMER TO FIT THE 3" TRUCK PUMP OUTLET FLANGE AFTER YEAR 2002 OR 2" PLANT PUMP	
1	ORINGS (FOR 3" MEC BACK CHECK AND 1-1/4 INTERNAL VALVE)	
	SUBTOTAL C	679.15
	D) DURING INSPECTION TECH FOUND THAT THE QUERY ALARM ISN'T WORKING WITH THE BASE UNIT, ALSO THE REAR GATE OVER THE SPRAYFILL AND VAPOR LINES IS REALLY TIGHT TO MOVE.	
3	LABOR CHARGE P/HR SUMMARY: TECH DIAGNOSED GUESTS CONCERN OF THE QUERRY NOT WORKING. INSPECTED AND FOUND BASE WORKING AS DESIGNED. ALARM IS FAILING. REPLACED ALARM AND RETESTED OPERATION. UNIT IS WORKING AS DESIGNED. REAR GATE WAS REMOVED AS PART OF LINE B.	
1	BACK UP ALARM	
	SUBTOTAL D	324.61
	E) DURING INSPECTION TECH FOUND THAT THE HR CHAIN IS WORN OUT AND ONE OF THE HYDRO RELIEFS ARE OVER 10 YEARS.	

WE THANK YOU FOR YOUR BUSINESS!

A 3% FEE WILL BE ADDED TO ALL INVOICES PAID WITH A CREDIT CARD

A FINANCE CHARGE OF 1.5% WILL BE APPLIED TO ALL PAST DUE INVOICES
ON THE 1ST OF EACH MONTH

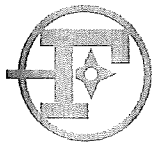

FELKER TRUCK AND EQUIPMENT INC

W9576 FELKER FLATS DR PO BOX 139 DALE, WI 54931
OFFICE: 820-779-9826 WWW.FELKERTRUCK.COM

Invoice

Date	Invoice #
11/17/2022	105943

Please Reference Invoice Number with Payment

Bill To
New Horizons Energy LLC 1775 4th Street Fennimore, WI 53809-1137

Ship To
New Horizons Energy LLC 1775 4th Street Fennimore, WI 53809

Unit/VIN	Mileage	Terms	P.O. No.	Project
P19-6643/7J466643	295340	NET 15	STEVE LUCEY	HYDRO/REPAIRS

Qty	Description	Total
3.25	LABOR CHARGE P/HR SUMMARY: TECH REPLACED WORN INNER AND OUTER HOSE REEL BEARINGS AND REALIGNED DRUM. REPLACED STRETCHED CHAIN AND ADJUSTED FOR PROPER TENSION. TESTED OPERATION AND REEL IS WORKING AS DESIGNED. REPLACED HYDROSTATIC RELIEFS OVER 10 YRS.	
1	#40 CHAIN PER LENGTH	
1	1-1/2 INNER SPLIT HOSE REEL BEARING	
1	1 S.A. BR BEARING	
2	HYDROSTATIC RELIEF 450 PSIG	
	SUBTOTAL E	524.09
3.25	F) DURING INSPECTION TECH FOUND THAT THERE WERE SOME DECALS THAT WERE FADED AND SOME LIGHTS THAT WERE OUT. LABOR CHARGE P/HR SUMMARY: TECH REPLACED DECALS AS REQUIRED TO MEET CODE. CHECKED OVER LIGHTING AND CHECKED POWER AND GROUND. REPLACED LIGHTS THAT WERE OUT. REPAIRED CORRODED WIRING AND REASSEMBLED. RECHECKED LIGHTS AND WORKING AS DESIGNED.	
1	SILVER CABINET OR LICENSE LIGHT LED TWO WIRE	
2	27 WATT LED FLOOD LIGHT SQUARE 1900 LUMENS	
2	TL1020SR LIGHT	
1	MISC. AUTO BULBS	
2	EMERGENCY SHUT OFF DECAL	
3	'PROPANE' VINYL ADHESIVE PLACARD (10 X 3)	
3	1075 VINYL DIAMOND DECAL	
1	'NQT' PLACARD DECAL 3 X 6.5	
	SUBTOTAL F	533.55
1	MATERIAL SURCHARGE FROM METER PARTS	13.22
1	CHARGE FOR SHOP SUPPLIES USED	490.88

WE THANK YOU FOR YOUR BUSINESS!

A 3% FEE WILL BE ADDED TO ALL INVOICES PAID WITH A CREDIT CARD

A FINANCE CHARGE OF 1.5% WILL BE APPLIED TO ALL PAST DUE INVOICES ON THE 1ST OF EACH MONTH

Subtotal	\$30,177.09
Sales Tax (0.0%)	\$0.00
Total	\$30,177.09